

PRODUCT SPOTLIGHT

ATRO BUMPER CHOICES


Did You **KNOW**?

- Today's typical rubber bumpers do not last very long and may be worn out in six to twelve months.
- ATRO's polyurethane bumpers have been proven to last as much as 15 times longer than rubber.

WASTE HAULER



TRAILER

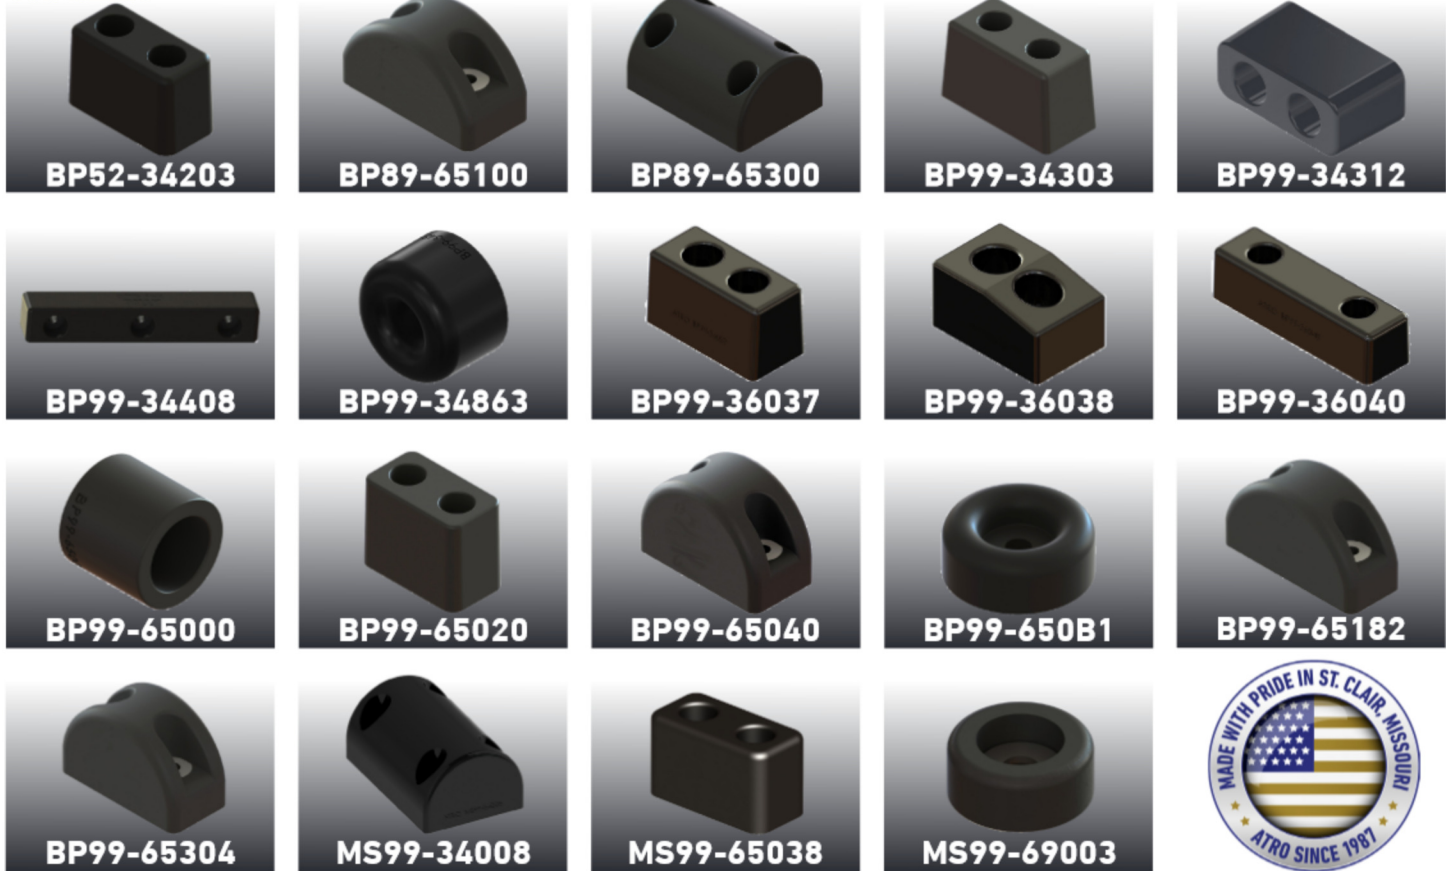

! Things TO CONSIDER

- Labor Cost
- Downtime
- Trailer Damage

Changing out a simple trailer bumper can present a technician with unexpected problems. Many of today's bumpers are mounted into a sealed bumper frame that contains the stop/tail/turn lamps. Often, a lamp will need to be removed to gain access to the rusted nuts on the inside of the trailer bumper frame. This is further complicated when the lamp is secured with a riveted lock ring, common with the newer LED powered stop/tail/turn lamps. The bumper removal process usually takes a minimum of 20 minutes and as much as 45 minutes to complete and often the lamp gets damaged in the process.

ATRO BUMPERS

ATRO PARTS
 ENGINEERED | DURABLE | RELIABLE
 MANUFACTURED IN ST. CLAIR, MISSOURI | U.S.A.

ATRO Part Number	Description	OEM Cross Reference	Height	Width	Length	ID	OD	Bolt Hole	Bolt Holes
BP52-34203	Trailer/Dock Bumper	Miscellaneous	3 3/4"	3"	6"			1/2"	3" c-c
BP89-65100	Trailer Bumper	Stoughton 04-86997-001-00	3 1/8"	2 15/16"	5 7/8"			1/2"	3" c-c
BP89-65300	Trailer/Dock Bumper	Stoughton	3.725"	5 1/2"	7 1/2"				5 3/8" c-c x 3" c-c
BP99-34303	Trailer Bumper	Great Dane SL3000W James King 3044	3 3/8"	2 3/4"	5 9/16"			1/2"	2 1/2" c-c
BP99-34312	Trailer/Dock Bumper	Wabash	3 1/4"	2 1/2"	6"				2.63" c-c
BP99-34408	Trailer Bumper	Fontaine 50407007	2"	2"	12"			1/2"	4 1/2" c-c
BP99-34863	Trailer Door Bumper	Great Dane 42500863			1.12"	.38"	1.7"		
BP99-36037	Trailer Bumper	Miscellaneous	3.3"	3"	6"			1/2"	2 1/2" c-c
BP99-36038	Trailer Bumper	James King 3043	3.2"	4"	6.1"			1/2"	2.4" c-c
BP99-36040	Trailer Bumper	Fontaine B552641 James King 3042 Vanguard RDB00002	1 3/4"	1 15/16"	7"			3/8"	4 1/2" c-c
BP99-65000	Trailer Door Bumper	Freightliner FTG 022 01085 Mack 9817-02201085 Sterling FTG 022 01085 Utility Trailer 3-1250-25 Volvo FLE02201085			1 5/8"		1 7/8"	1/2"	
BP99-65020	Trailer Bumper	James King 3035 Utility Trailer 03-1250-0-214	3 1/2"	2 5/8"	4 5/8"			7/16"	2 3/8" c-c
BP99-65040	Trailer Bumper	James King 3630 Kentucky Trailer T-9000 Utility Trailer RDB-003 Wabash WAB21400098	3 3/4"	3"	5 3/4"			1/2"	3 1/2" c-c
BP99-65081	Door Bumper	James King 3050	1"			.45"	2 1/2"		
BP99-65182	Trailer Bumper	Benson Trailer B52641 Great Dane 035-25182	3 1/2"	2 1/2"	6 1/4"			1/2"	3 3/4"
BP99-65304	Trailer Bumper	Great Dane 41700301; 41700304	3 1/2"	2 3/4"	5 5/8"			1/2"	2 3/4" c-c
BP99-65535	Bumper/Arm Stop	Heil 01411535	2 13/16"	4 1/2"	9 7/8"			5/8"	5" c-c
MS99-34008	Trailer/Dock Bumper	Great Dane 30036; 41700322	3 5/8"	5 1/2"	8"			.775"	3.4" x 5.5" c-c
MS99-65035	Bumper Pad	McNeilus 0602035	3"	6"	7 7/8"			1/2"	5 1/2" x 3" c-c
MS99-65038	Trailer Bumper	McNeilus 0120500 Stoughton 04-85104-PLY-00	3 1/2"	3"	6"			1/2"	3" c-c
MS99-65045	Bumper Pad (Severe Duty)	McNeilus 0602035	3"	6"	7 7/8"			1/2"	5 1/2" x 3" c-c
MS99-69003	Ladder Bumper	RBR Enterprises 2500393	5/8"				1 1/2"	3/8"	
MS99-69717	Grabber Assembly Roller	Heil 0620717 McNeilus 1108125			1 7/16"	1/2"	2 1/2"		
MS99-69804	Roller Gripper	Heil 0620804 tri-cuff Heil 0620805 2 pcs stacked/tricuff			2"		2 1/2"	5/8"	

ATRO
 POLYURETHANE • SOLUTIONS

POLYURETHANE PARTS | SOLUTIONS FOR HEAVY TRUCKS

ATROBUSHING.COM
 ©2018 ATRO ENGINEERED SYSTEMS, INC.

6 Bolte Lane
 St. Clair, Missouri 63077 | U.S.A.
 (800) 325.6114 | Fax (866) 920.2005

ATRO Engineered Systems, Inc. is not liable for any errors herein. All manufacturers' names and part numbers are used without permission; no endorsement, affiliation, or recommendation is implied. They are included for reference purposes only.